


#### 4\_3 MISSING CENTERLINE PGL POINT

##### Question:

Why are the supers not labeled in the XSC and I am unable to pick the centerline point "PV1\_PGL" to apply the super?


##### Answer:

Issue was caused by an older template created to seek both the inside and outside edges of existing pavement on an undivided facility. When no inside existing EOP graphics were found, all of the inside pavement components, including the "PV1\_PGL" point, were turned off as a display rule. The issue affects Undivided Facility Shoulder Templates only. C&G and Divided Facility Templates are not affected. Please check the revised date of the template you are using (under the Description field) and use or replace the current template with Shld Section Undivided Facility Templates created or modified on January 19, 2012 or later. This should fix problem.

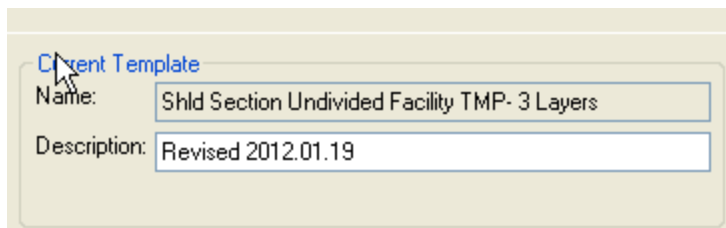

A screenshot of a software dialog box titled "Current Template". It contains two text input fields. The first field is labeled "Name:" and contains the text "Shld Section Undivided Facility TMP- 3 Layers". The second field is labeled "Description:" and contains the text "Revised 2012.01.19". A mouse cursor is visible pointing at the "Current Template" title.

In this case, a template dated November 18, 2011 was used causing the problem. The remaining two "Shld Section Undivided Facility w/o GR Warrant" templates (for sub-regional tier projects) will be updated later on today.

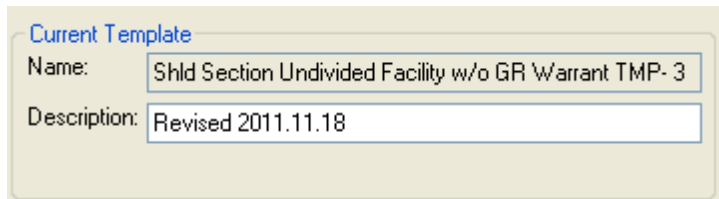

A screenshot of a software dialog box titled "Current Template". It contains two text input fields. The first field is labeled "Name:" and contains the text "Shld Section Undivided Facility w/o GR Warrant TMP- 3". The second field is labeled "Description:" and contains the text "Revised 2011.11.18".